



System Firmware Update Instructions for Pioneer In-Dash AV Receivers (DMH-ZF9350BT, DMH-ZS9350BT, DMH-Z6350BT)

This firmware update applies only to the following models of Pioneer In-Dash AV Receivers sold in India.

DMH-ZF9350BT
DMH-ZS9350BT
DMH-Z6350BT

IMPORTANT

Please download and print these firmware update instructions before downloading and installing the firmware update. It is important that you complete all steps correctly and in the order described below.

Note: If you have any questions, please contact Pioneer Customer Service toll free at 1800-103-5787 Monday through Friday, 9:00 AM - 05:30 PM, excluding holidays, or email us at pincustomercare@pioneer.com.sg

In order to perform this update, the following items are needed:

- Pioneer In-Dash AV receiver listed above.
- A CarAVAssist App

CAUTION


- **DO NOT** turn your unit off and Smartphone Off while the firmware is being updated.
- You can only update the firmware when the vehicle is stopped and the parking brake is engaged.

Checking the firmware version

Check whether the firmware of your unit needs to be updated by checking the version number of the firmware.


Procedure:

1. Touch the following key.

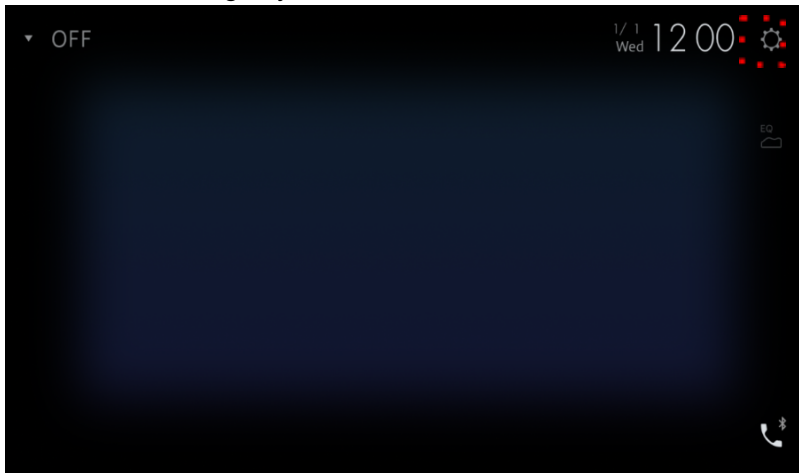


The “System” screen appears.

2. Scroll down the list and touch [System Information].

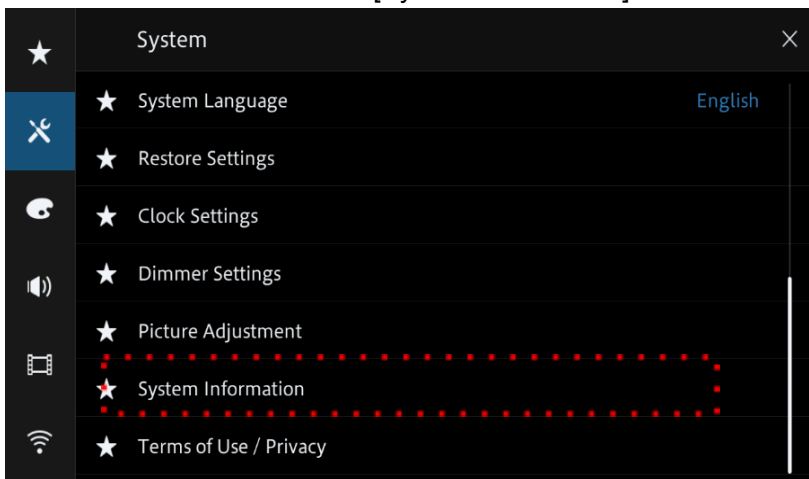

3. Touch [Firmware information].

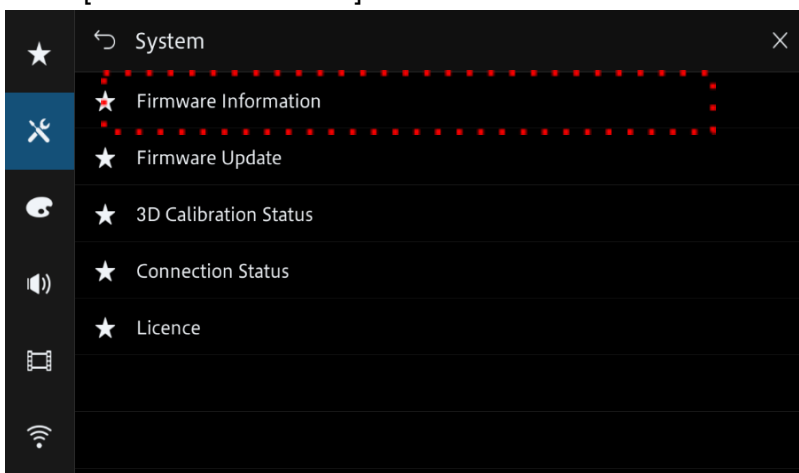

4. After the “Firmware Information” screen appears, Check the firmware version number and model name.
Firmware Version should be lesser than 2.01

★

↶ Firmware Information

×

⚙

Firmware

1.00

Model Name

SPH-EVO93DAB



Updating the firmware on your unit


IMPORTANT

Model Name	Update is necessary when	File Name	Version
DMH-ZF9350BT	Current version is Lower than 2.01	DMH-ZF9350BT.avh	2.01
DMH-ZS9350BT	Current version is Lower than 2.01	DMH-ZS9350BT.avh	2.01
DMH-Z6350BT	Current version is Lower than 2.01	DMH-Z6350BT.avh	2.01


- DO NOT perform this firmware update if the model number of your Pioneer product is anything other than one of the above models.
- While your unit is being updated, DO NOT turn off the system's power
- Performing the firmware update will restore all settings to their default values.

Procedure:

1. Connect your smartphone to this unit via Wi-Fi Hotspot Settings (go to Unit's Settings, Go to communications settings , Wi-Fi Settings: Hotspot, Hotspot Setting, Search Your Smartphone and give password to connect)
2. Connect CarAVAssist App via Bluetooth
3. Download the Firmware update file into your Smartphone through CarAVAssist App.
4. Set the audio source to "OFF" on your unit
5. Download the firmware version 2.01

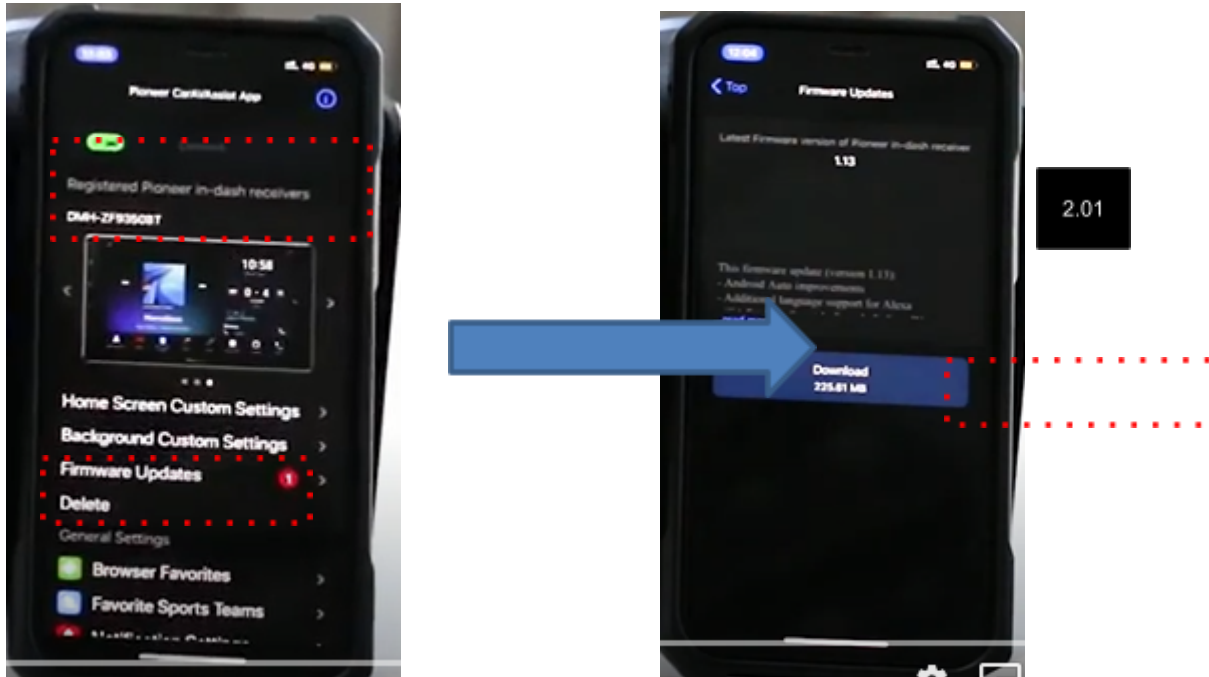

6. Check that Wi-Fi, Bluetooth and CarAVAssist App, all are in Active mode (highlighting that smartphone is connected)

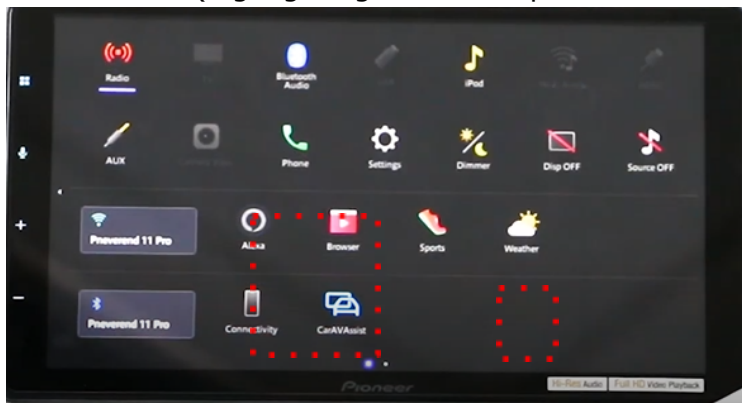


7. Touch the following keys in the following order or go to Settings




The “System” screen appears.


8. Scroll down the list and touch [System information].

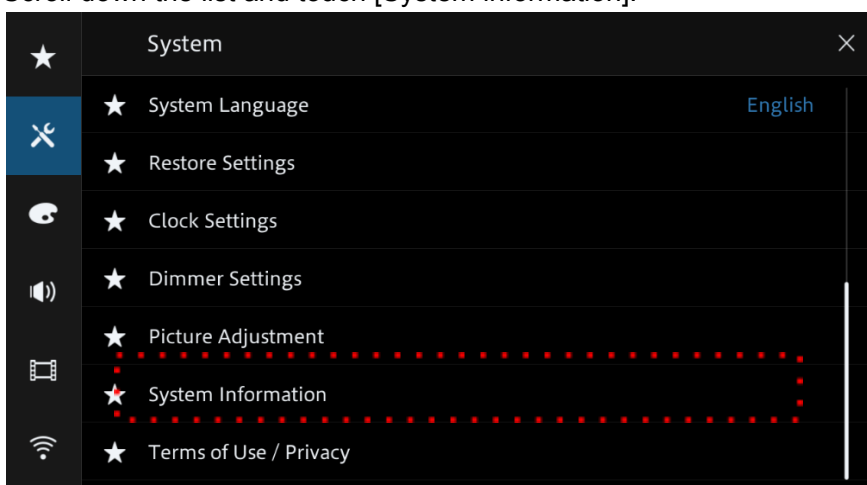



9. Touch [Firmware Update]. The “Firmware Update” screen appears.

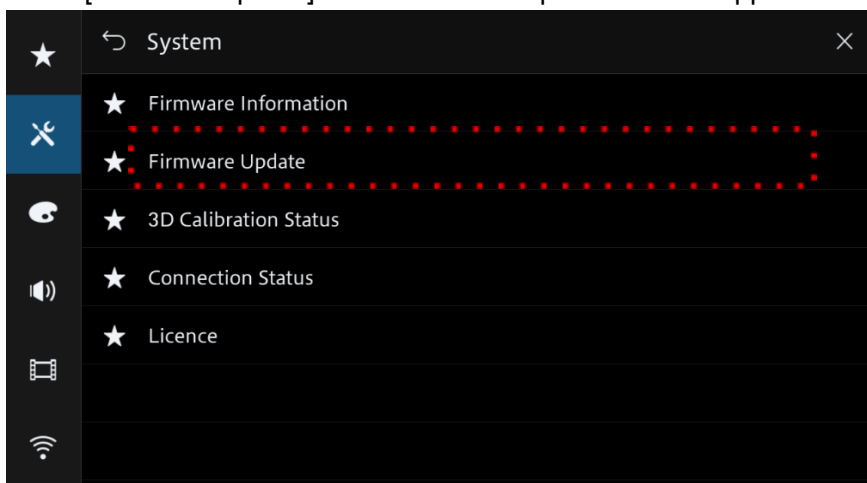

10. Touch [CarAVAssist].

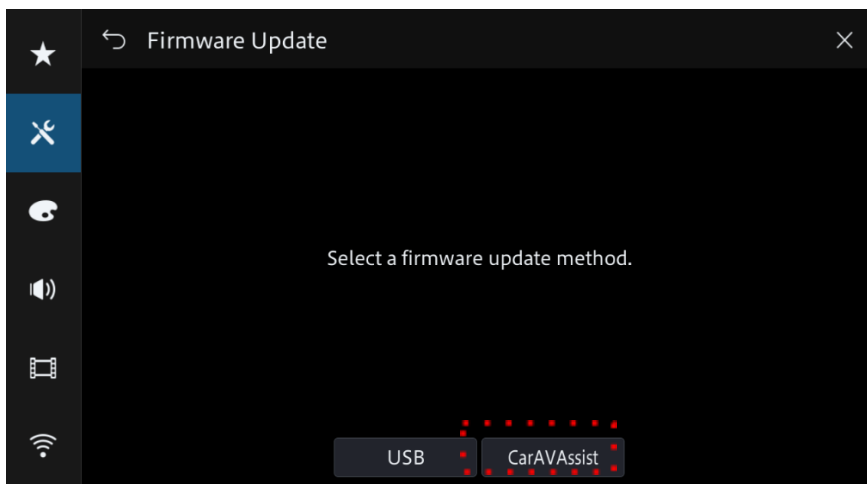


11. Touch [Continue] to display the data transfer mode.

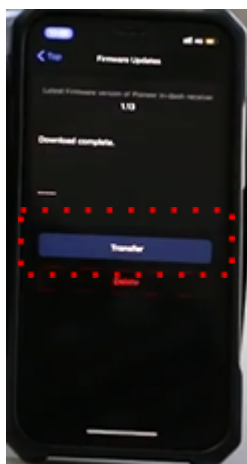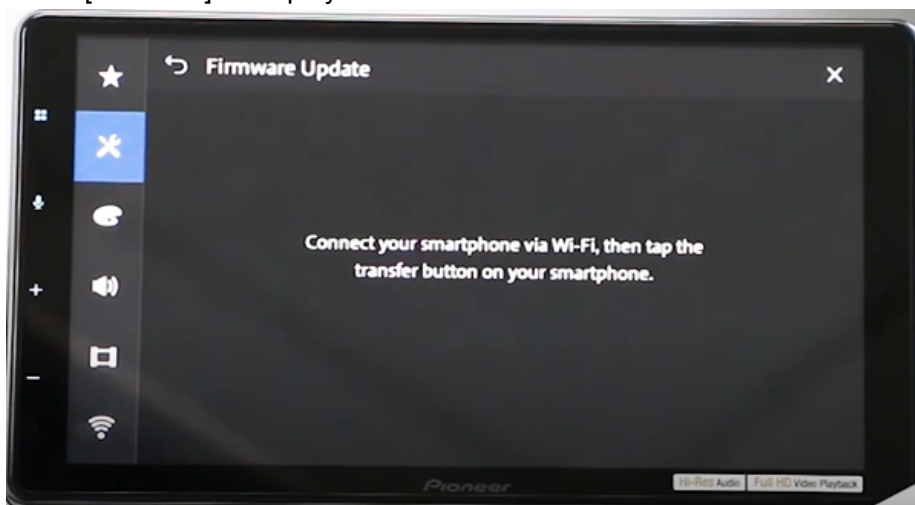


12. It will take a while to load, so please wait.

13. Read the "WARNING," then touch the [Start] button to start the update process.

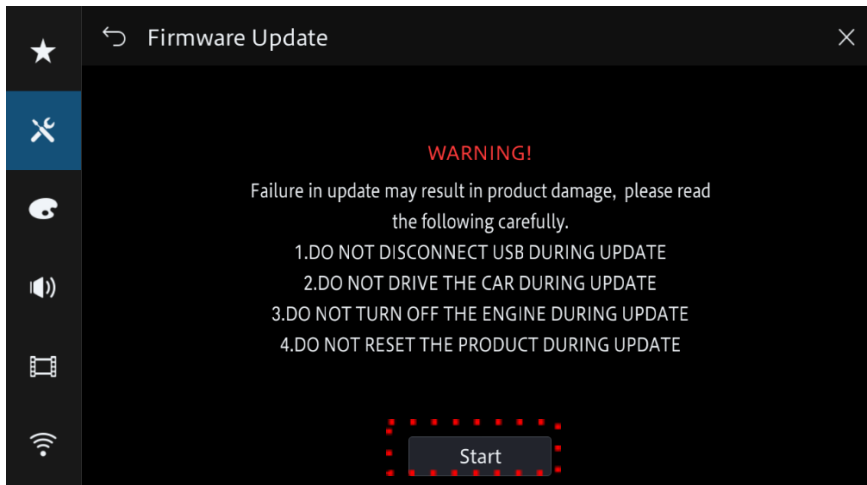


Version up will start.

14. The progress is displayed during the updating.

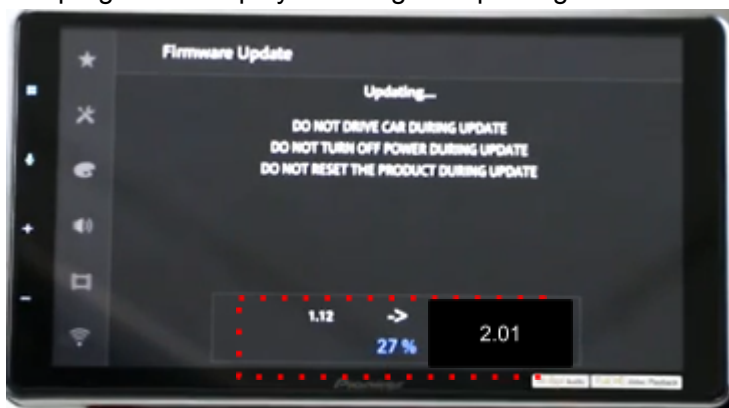


DO NOT turn your unit off or smartphone while the firmware is being updated.
Do Not touch Screen

15. The product will reboot after the update is finished. Do not touch anything even when the screen is blacked out. After it has finished rebooting, the screen will return to the menu screen.

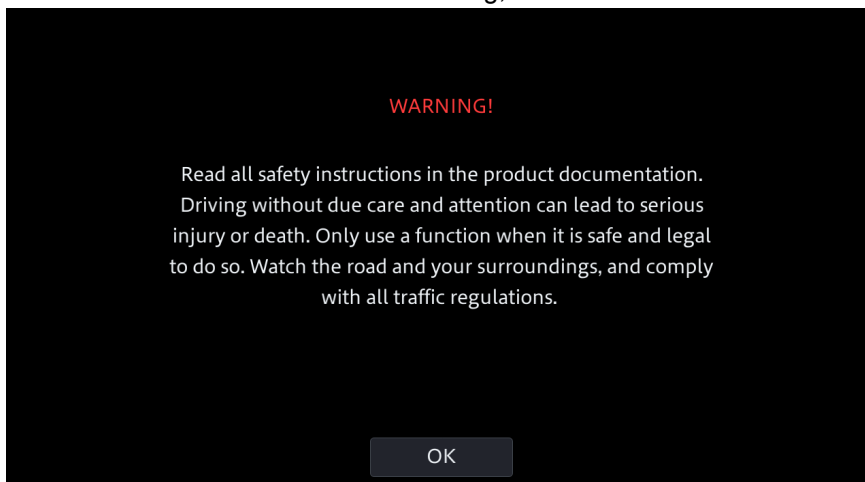

16. Display will show "It succeeded..." when the update is complete.
The firmware update is now complete. Your Pioneer AV Receiver is now ready for use.

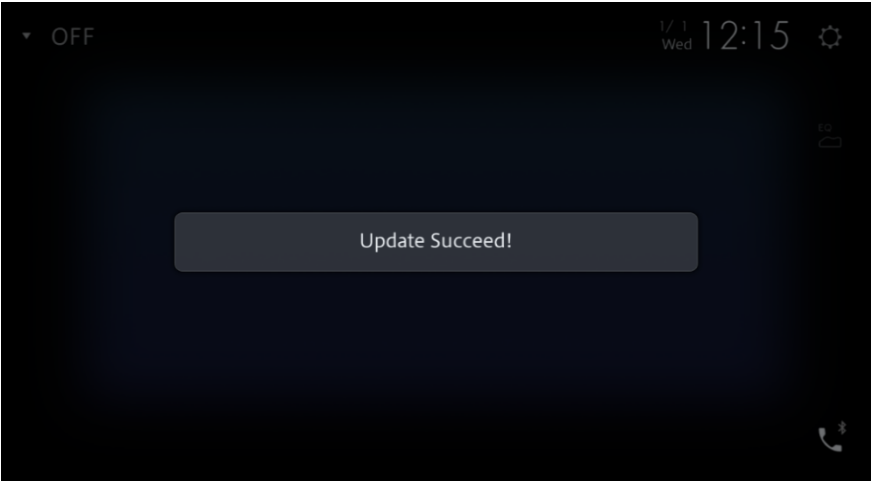


Confirm that the firmware has been updated

Perform the same procedure for “Displaying the firmware version” to confirm that the firmware has been updated.


Procedure:

1. Touch the following key or settings

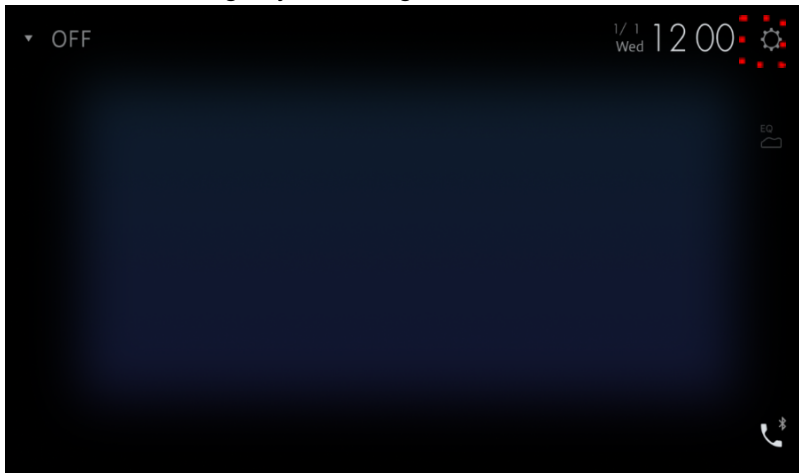


The “System” screen appears.


2. Scroll down the list and touch [System Information].

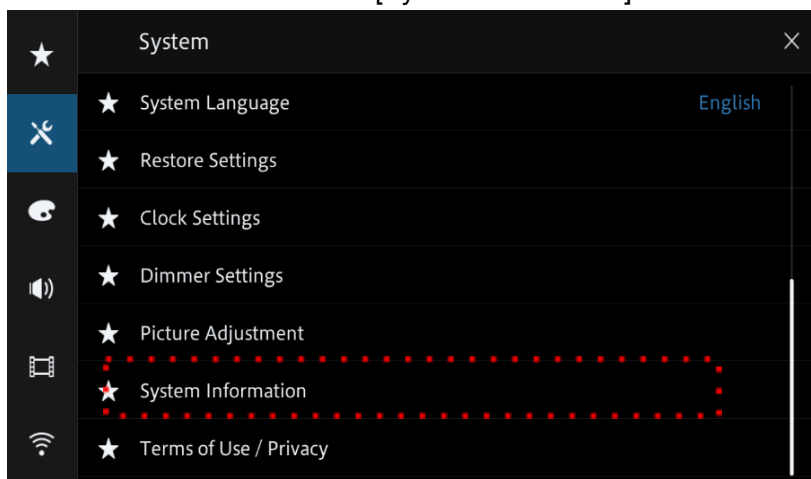

3. Touch [Firmware information].

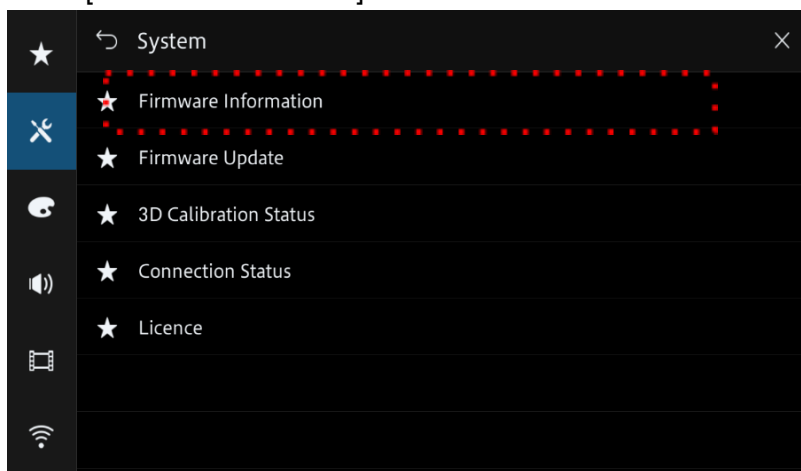

4. After the “Firmware Information” screen appears,
Check the firmware version number and model name.
Firmware Version now should be 2.01

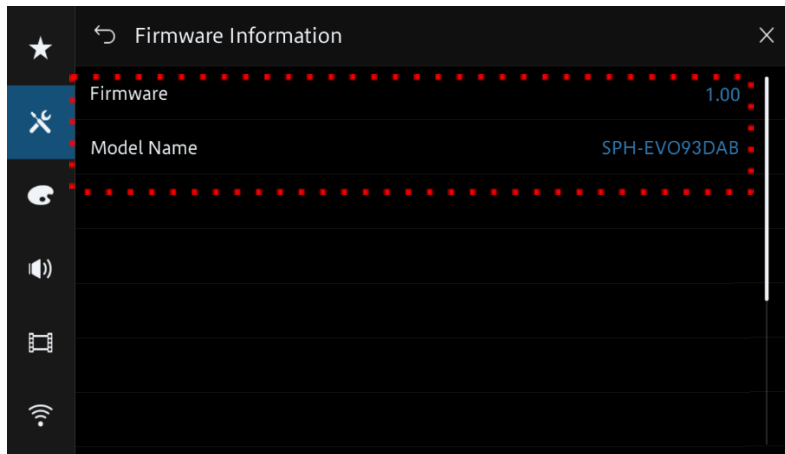

If you have any difficulty performing these instructions, please contact Pioneer Customer Service toll free at 1800-103-5787 Monday through Friday, 9:00 AM - 05:30 PM, excluding holidays, or email us at pincustomercare@pioneer.com.sg.

Contact Information

Pioneer India Electronics Ltd

Unit No. 3, 10th Floor, Ambience Corporate Tower II

Plot No. 3, Ambience Island, NH-8 Gurugram, Haryana – 122002, India

Office Timing: 9 A.M. to 5 P.M. on Monday to Friday

Toll Free: 1800-103-5787

Direct Links:

Web: <https://pioneer-india.in/>

Customer Support: pincustomercare@pioneer.com.sg

Copyright 2022 Pioneer Corporation