
ขั้นตอนการติดตั้ง Driver HMI ใน Windows 10

1. ติดตั้ง Driver HMI ใน Win10

- เสียบสาย USB HNI(USB DEVICE) to PC
- เช็คใน Device manager Port(COM & LPT) มันจะขึ้น USB Device (COM3)
- ซึ่งมันติดต่อกับ PC ได้ แต่ยังไม่มี CoolMay Driver
- จะต้อง Uddate Driver ให้มัน แต่ก่อนที่จะ Update จะต้อง Disable driver signature enforcement ก่อน.
- 1) click "Start button" -> "Setting"
- 2) Click "Update & Security"
- 3) Click "Recovery" -> "Restart now"
- 4) PC Restart
- 5) Click "Troubleshoot" -> "Advance options"
 - 6) ที่ Advance options Click "Startup Setting"
- 7)ที่ Startup Setting Click "Restart"
- 8) PC Restart
 - 9) ที่ Startup Settings กดเลข 7 (Disable driver signature enforcement)
- 10) Re-start PC


2.Update Driver

1) Click ขวา USB Device -> "Update Driver"

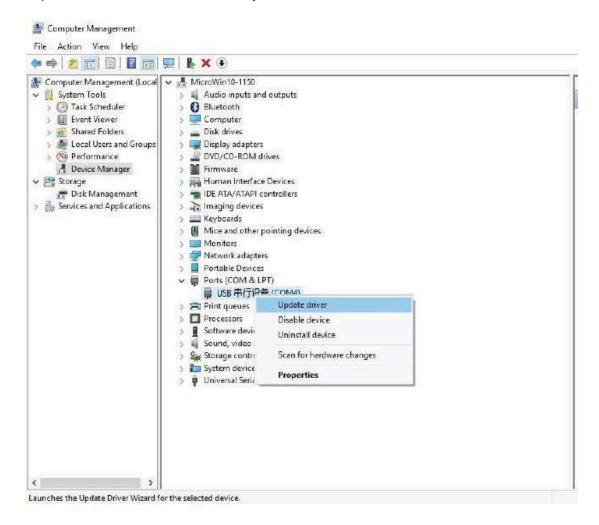

2) Click "Browse my computer for driver software"

3) Click "Let me pick from a list of available drivers on my computer" -> "Next"

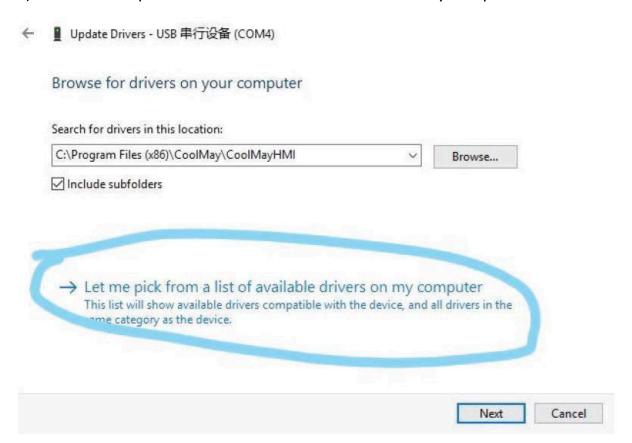

4) Chose "CoolMayHMI" -> "Next"




5) Chose "Install this driver software anyway"




3. ที่ Device manager

1)Network adapters ->จะมี "CoolMayHMI" โชว์ขึ้นมา

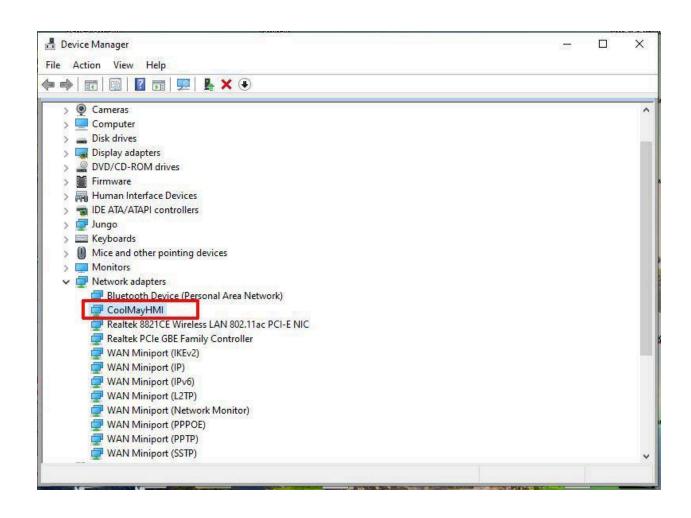


1) Open Neywork connection

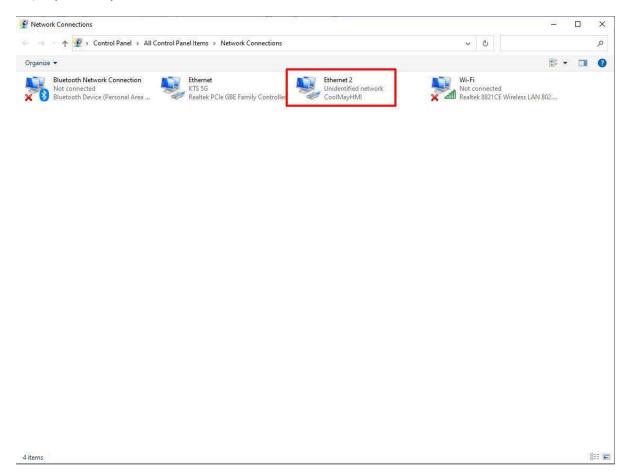

- 2) Click ขวา "Network CoolMayHMI" -> Properties
- 3) Double-click -> "Internet Protocol Version 4(TCP/IPv4)
- 4. Input IP Address: 222.222.222.6


Subnet mask:255.255.255.0

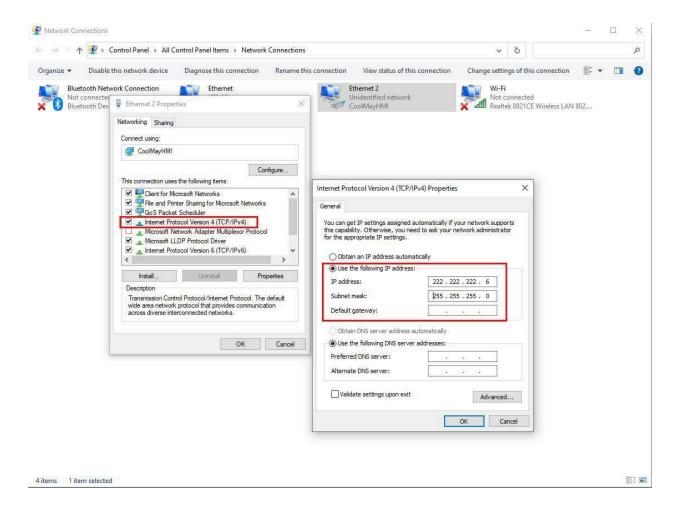


5) Click OK

5.ON Run as administrator CoolMayHMI

- 1) Click ขวา CoolMayHMI icon
- 2) click Properties -> "Advanced"

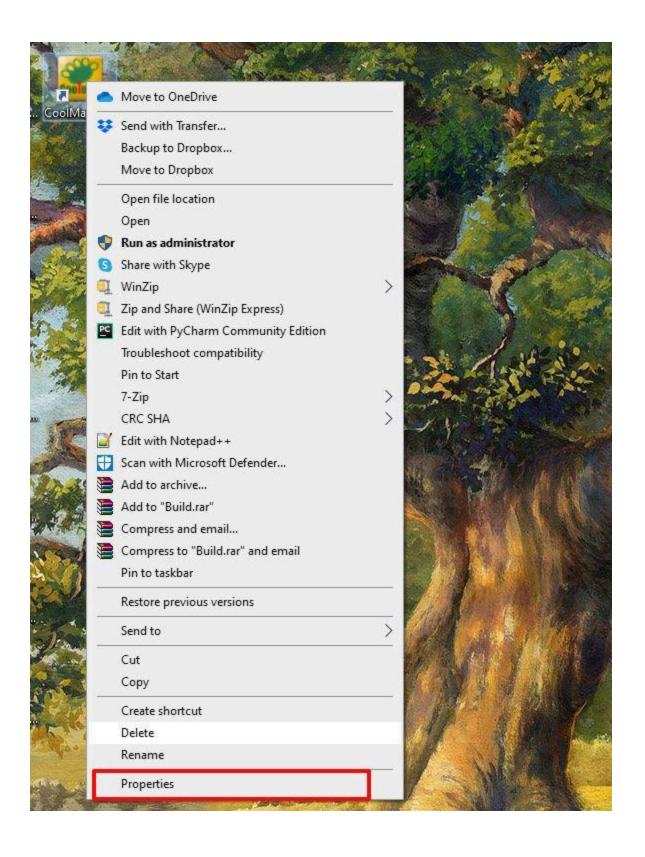

3) Click Mark ON Run as administrator

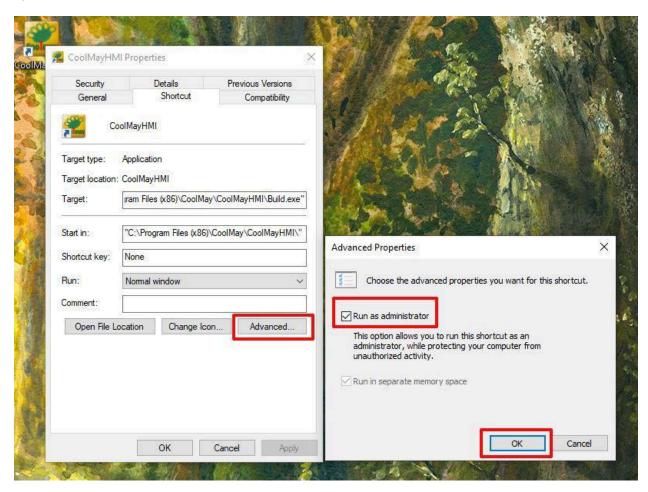

4) Click OK