

Super X System Reinstallation Guide


Creating a Bootable USB Drive

Prepare a 16GB or 32GB USB flash drive.

Format the USB drive to **FAT32** format (see Figure 1).

Note: NTFS format cannot be used to boot the system.

Rename the USB drive to: **WINPE**

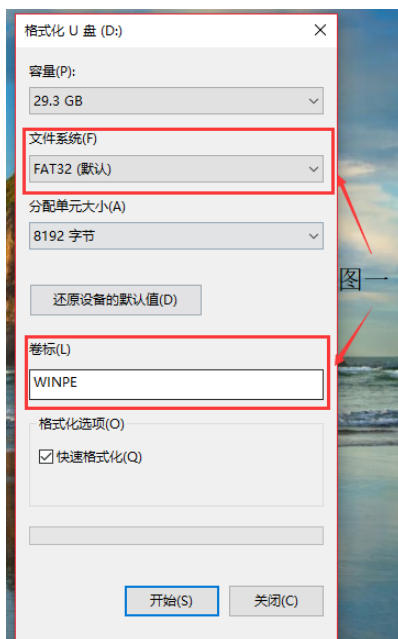

⚠ Reinstalling the system will erase all data.

Method 1: System Installation

Step 1: Download System Image


(Do NOT download directly to the USB drive. Download to another location first, then copy to the USB.)

Baidu Cloud Download Link:

<https://drive.google.com/drive/folders/1NxUucHsY3ei3EUSFO9ObQlqZtlfmw5Pu?usp=sharing>

Step 2: Copy Files

Copy the downloaded system files to the **root directory** of the USB drive (the first directory when opening the USB).

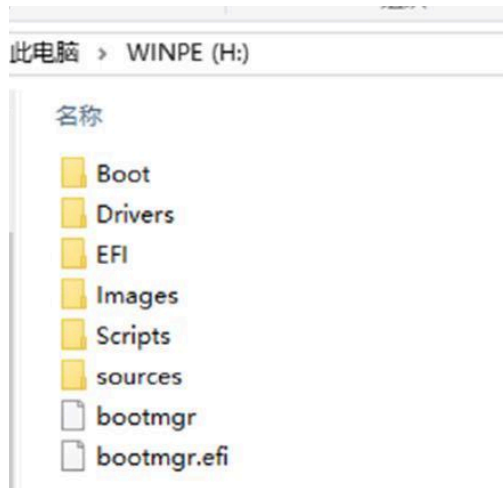


Step 3: Boot from USB

1. Insert the USB drive into the device
2. Press and hold the **power button for 2 seconds** to start the device
3. When the power indicator lights up, repeatedly press the **Turbo button** to enter the BIOS boot menu
4. Select the detected USB drive (e.g., **USB partition 1**)



Step 4: Install System

Press **Enter** to begin automatic system installation.
Please wait patiently for the installation to complete.

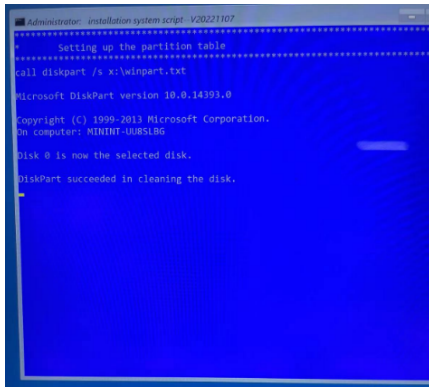

```
Administrator: installation system script: 9/20/21/107
=====
+ setting up the partition table
=====
call diskpart /s x:\winpart.txt

Microsoft DiskPart version 10.0.14393.0
Copyright (C) 1999-2013 Microsoft Corporation.
on computer: MINIMI-U085L86

Disk 0 is now the selected disk.
DiskPart succeeded in cleaning the disk.
```

Step 5: First Boot

After installation is complete, the device will restart automatically.

Remove the USB drive, and the system will enter the initial setup page (language selection interface).

Step 6: Network Setup

When reaching the network connection page:

- If connected to the internet, the system will **force login to a Microsoft account and perform updates** (this may take a long time)
- If you do NOT want to update immediately:
 - Select **“I don’ t have internet”**
 - Continue setup and connect to the internet later

Method 2: Install via Microsoft Tool

Step 1: Download Installation Tool

Official Windows 11 Download Link:

<https://www.microsoft.com/zh-cn/software-download/windows11>

⚠ After installation, you will need to manually download and install the full driver package.

创建 Windows 11 安装

如果要在新电脑或旧电脑上重新安装 Windows 11 或执行全新安装，请使用此选项下载创建工具，以制作可引导的 USB 或 DVD。

 开始之前

立即下载

Step 2: Prepare USB

Copy the downloaded **Microsoft installation tool** to the root directory of the USB drive and run it.

 MediaCreationTool22H2.exe	2023/4/23 16:41	应用程序	19,008 KB
---	-----------------	------	-----------

Step 3: Run Installation Tool

Follow the steps below:

1. Accept the license terms
2. Uncheck “Use the recommended options for this PC”

 Windows 11 安装程序

— □ ×

适用的声明和许可条款

请阅读此文档，了解其中内容。

微软软件许可条款

MICROSOFT MEDIA CREATION TOOL

如果您居住（或者您的业务所在地，这里指业务主营业地）在美国，请阅读下文“具有约束力的仲裁和共同起诉弃权”一节。它影响争议的解决方式。

这些许可条款是您与微软公司（或其关联公司）之间达成的协议。这些条款适用于上述软件 and 任何 Microsoft 服务或软件更新（但该软件或服务更新附有新的或额外条款的情况除外，在这种情况下，那些不同的条款预期会适用，并且不会改变您或 Microsoft 的有关更新的软件或服务的权利）。如果您遵守这些许可条款，您将拥有以下权利。使用该软件，即表示您接受这些条款。

1. 安装和使用权利。

- a) **一般条款。** 您仅可出于上述目的以及出于内部业务的目的安装和使用一个副本，以开发和测试您的应用程序并且仅在 Windows 上使用。您仅可出于重新安装软件之目的对软件做一个备份副本。

隐私声明

 Microsoft 支持 法律

拒绝(D)

接受(A)

Manually select Windows 11



Choose installation media as USB drive



Select the target USB drive




The tool will begin downloading and creating the installation media
After completion, click **Finish**




Step 4: Install System

1. Insert the USB drive into the device
2. Press and hold the power button for 2 seconds to start
3. Repeatedly press the **Turbo button** to enter BIOS

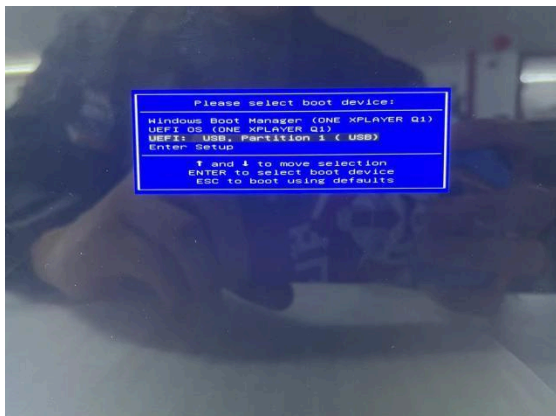




1. Select the USB drive (e.g., USB partition 1)
2. Press Enter

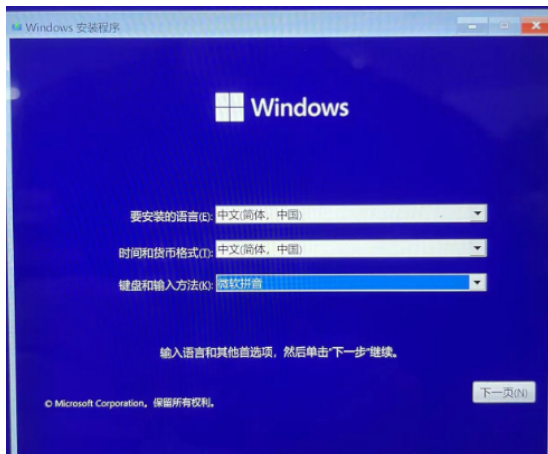

Step 5: Windows Installation

1. Select language, time, and region → click **Next**
2. Click **Install Now**
3. Accept the license terms → click **Next**
4. Select **Custom: Install Windows only**


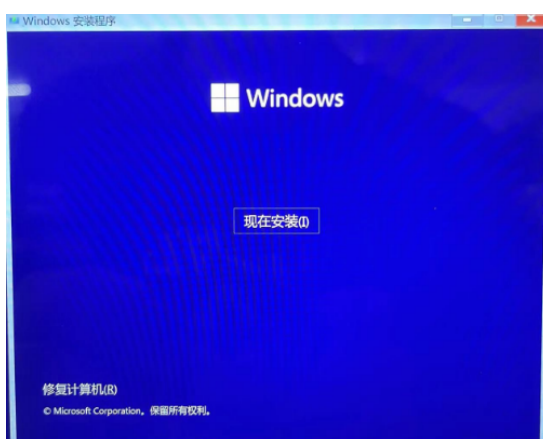


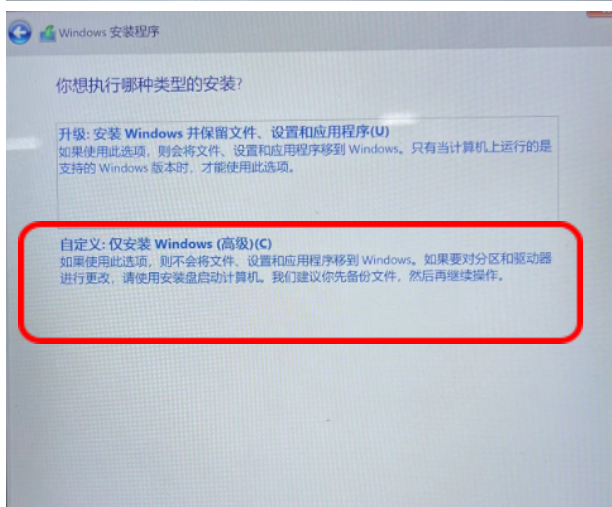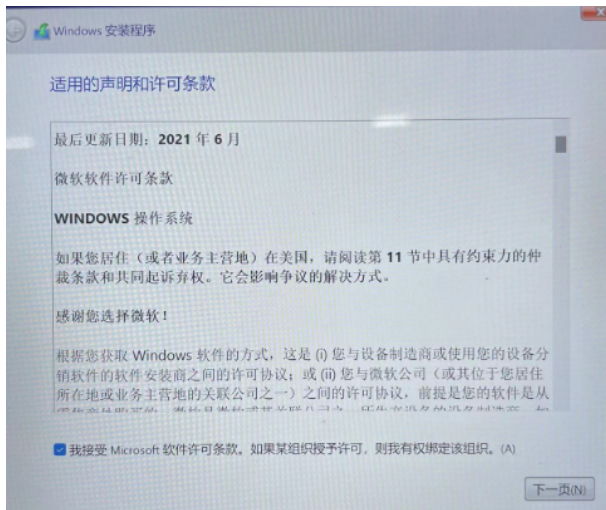

Step 6: Disk Setup

1. Select the **Windows partition**
2. Click **Format** to format the disk
3. Select the partition again → click **Next** to install



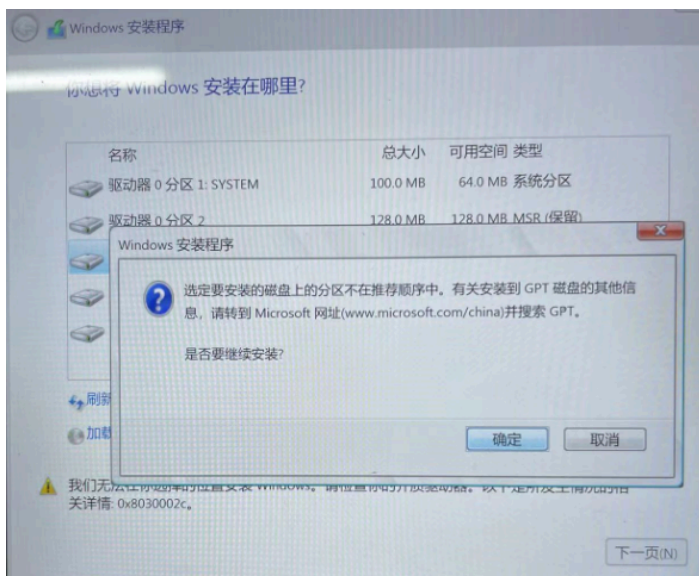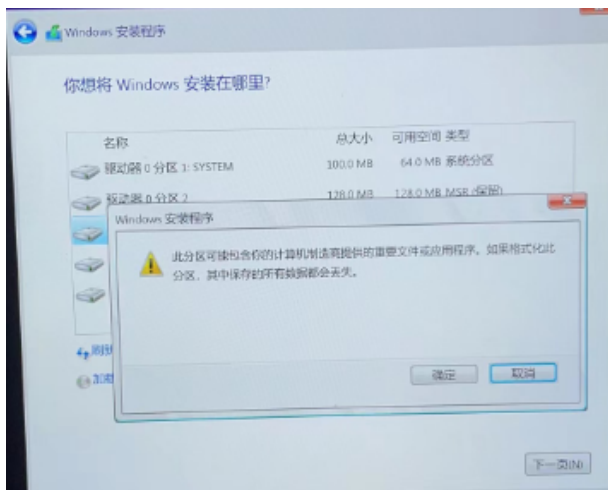


Step 7: Installation Process

The system will install automatically.

After installation, the device will restart automatically.

No manual operation is required—just wait.

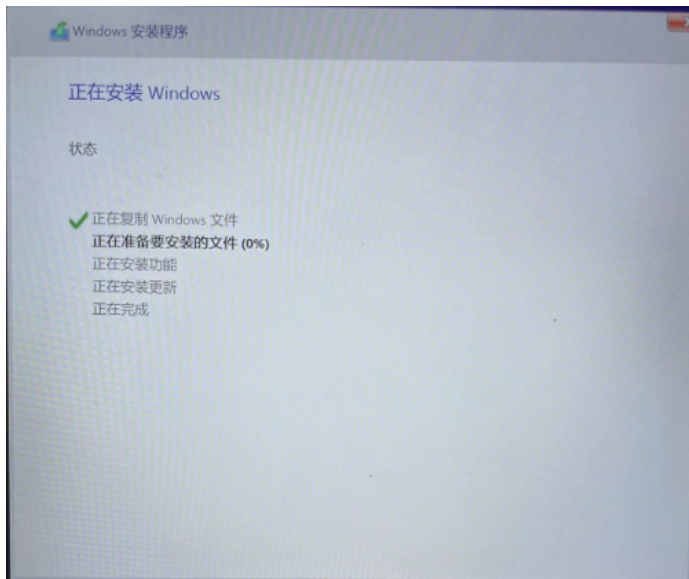

⚠ Note:

Using this method requires **manual driver installation after entering the system.**

Driver Installation

Driver Package Name:

HH-GA25-SUPERX-Devices_V1.0.zip

Download Link:

https://drive.google.com/drive/folders/14tdmaS3NDxu1_dqRSjNc6Adnu0n4n6KB?usp=sharing

Installation Steps:

1. Extract the downloaded file
2. Right-click **install.cmd** or **install.bat**
3. Run as **Administrator** to install drivers